

ISTA  
system  
version

**4.01.21.17412**

Vehicle

**3'/E91/Sports**

**Wagon/320d/N47/AUTO/ECE/LL/2009/04**

---


**63 13 080**

**Removing and  
installing/replacing left  
direction indicator insert  
from series status 09/2008**



**Necessary preliminary tasks:**


- Remove [left headlight](#)

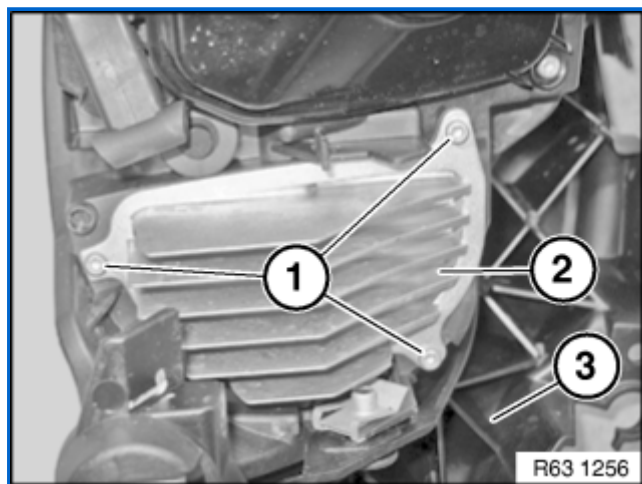

Release screws (1).

Tightening torque [63 12 9AZ](#) .

Remove direction indicator insert (2) from headlight (3).

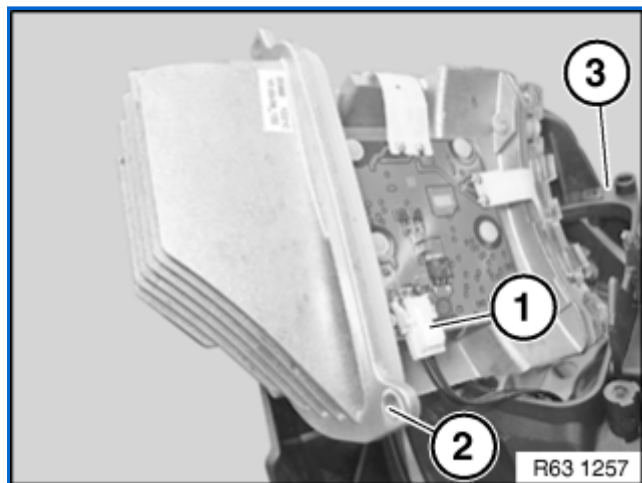

Unfasten plug connection (1) and disconnect.

Remove direction indicator insert (2) from headlight (3).